
Ventilation flaps engine failure - E1000.04

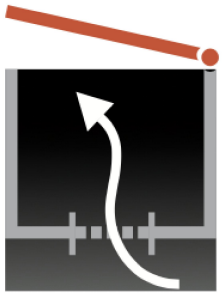

The E1000.04 alarm appears on Rika pellet stoves when the air vents are not in the correct position.

Solution

1. Clear the error message
2. Turn off the power, insert the socket wrench with handle, and manually open the ventilation flaps fully, then close them again
3. Restore power